



Plate 1 - Suntrap - stormwater pipe causing local erosion of bank.JPG



Plate 2 - Suntrap - Second stormwater pipe causing local erosion of bank.JPG



Plate 3 - Suntrap - Local Authority has removed debris from pool and retaining wall for installation of the sewer pipe.JPG



Plate 4 - Suntrap - debris from pool and retaining wall removed by Local Authority.JPG



Plate 5 - Suntrap - Local Authority clearing debris for repair of pipe line.JPG